

Clogging Indicators

DG 100 · DG 101 · DG 200 · DG 813 · DG 815 · DG 819 · DG 902

for Suction or Return Filters · Connection G¼ resp. M12 x 1.5 · Response / switching pressure up to 2.5 bar / 36.3 psi







Manometer DG 100



Pressure switch DG 815


Description

Application

Monitoring the contamination of suction resp. return filters.

General

Filter elements installed in hydraulic filters remove dirt from a hydraulic system and therefore become contaminated themselves. Free pores or spaces in the filter material are obstructed by dirt particles, which causes a continuous increase in the pressure loss.

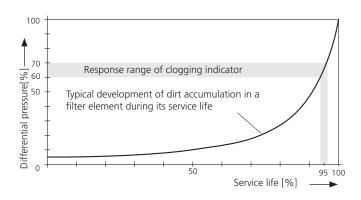

The dirt load collected in a filter element gradually increases during service, which also leads to a higher pressure drop. The resulting vacuum or back pressure is monitored by a clogging indicator. Once a preset value is reached, an electrical and / or optical signal is generated.

The following must be observed in this context:
The pressure drop caused by the filter element increases depending on the flow rate, the dirt load, and the viscosity of the pressure fluid. Therefore, a filter element is not regarded contaminated before the clogging indicator responds at operating temperature of the hydraulic system, causing a continuous signal.

Consequences of an overdue filter element change

Filters with by-pass valve:

The more dirt has collected in the filter element, the more frequently the bypass valve opens and part of the hydraulic fluid remains unfiltered. The high pressure drop causes unnecessary power consumption.

Suction filters without by-pass valve:

There is a high risk of pump cavitation with increasing vacuum caused by contaminated elements.

	DG 100	DG 101	DG 902	DG 200	DG 813	DG 815	DG 819	
Operating pressure	-1.0 +0.25 bar	-1.0 +0.25 bar	-0.5 +1.0 bar	0 + 10.0 bar	0 + 10.0 bar	0 + 10.0 bar	0 + 10.0 bar	
	-14.5 +3.6 psi	-14.5 +3.6 psi	-7.3 +14.5 psi	0 +145 psi	0 +145 psi	0 +145 psi	0 +145 psi	
Connection	Threaded ports according to ISO 228 or DIN 13. Sizes see Selection Chart, column 6 (other port threads on request).							
Hydraulic fluids	Mineral oil and	d biodegradable	fluids (HEES an	d HETG, see inf	o-sheet 00.20)			
Temperature range of fluids	-30 °C +100 °C (short term +120 °C)	-30 °C +100 °C (short term +120 °C)	-15 °C +100 °C (short term +130 °C)	-20 °C +90 °C	-30 °C +100 °C (short term +120 °C)	-30 °C +100 °C (short term +120 °C)	-30 °C +100 °C (short term +120 °C)	
	-22 °F +212 °F (short term +248 °F)	-22 °F +212 °F (short term +248 °F)	+5 °F +212 °F (short term +266 °F)	-4 °F +194 °F	-22 °F +212 °F (short term +248 °F)	-22 °F +212 °F (short term +248 °F)	-22 °F +212 °F (short term +248 °F)	
Ambient temperature range	-30 °C +80 °C	-30 °C +80 °C	-30 °C +80 °C	-20 °C +90 °C	-30 °C +80 °C	-30 °C +80 °C	-30 °C +80 °C	
	-22 °F +176 °F	-22 °F +176 °F	-22 °F +176 °F	-4 °F +194 °F	-22 °F +176 °F	-22 °F +176 °F	-22 °F +176 °F	

^{*} Design-related the switching tolerance increases at temperatures -15 $^{\circ}$ C / +5 $^{\circ}$ F.

Characteristics

Materials	
DG 100:	Housing steel, fitting brass, seal copper
DG 101:	Housing steel, fitting brass, seal copper
DG 902:	Housing brass, protection cap polyamide,
	diaphragm FPM, seal NBR
DG 200:	Housing polyamide, fitting brass, seal PTFE
DG 813 / DG 819	: Housing steel galvanized, protection cap
	NBR, diaphragm NBR, seal copper
DG 815:	Housing polyamide, fitting steel galvanized,
	diaphragm NBR, seal copper

Operating voltage

10 ... 30 V DC

(only required for clogging indicators with built-in LEDs).

Electrical service life

DG 902/DG 813/DG 815/DG 819: min. 10⁶ switching cycles

Electrical protection

> DG 902: IP 44 (with protection cap)

> DG 813: IP 65 (switch housing), IP 54 (with protection cap)

> DG 815: IP 65 (with mounted and secured socket)

> DG 819: IP 67 (in connected condition)

Electrical connection

> DG 902:	Flat plugs DIN 46247 - 6.3 x 1 / 0.25 x 0.04 Cable diameter approx. 6.5 mm / 0.26 inch
) DG 813:	Flat plugs DIN 46244 - A 6.3 - 0.8 / 0.25 x 0.03 Cable diameter approx. 4 mm / 0.16 inch
> DG 815:	Socket DIN 43650 - AF3 Cable diameter 6 8 mm / 0.24 0.31 inch
> DG 819:	Mating plug AMP Superseal and Deutsch DT04-2P resp. Cable diameter approx. 4 mm / 0.16 inch

Mounting position

No limitation

Page 386 www.argo-hytos.com

DG 100 / DG 101 - Manometer for Suction Filters



DG 902 - Vacuum Switch for Suction Filters (change-over)



DG 200 - Manometer for Return Filters



DG 813/DG 819 - Pressure Switch for Return Filters (make/break)



DG 815 - Pressure Switch for Return Filters (change-over)



Function:

Manometer for optical monitoring of the dirt load in suction filters

Green reading area = filter element O.K., Red reading area = filter element clogged.

Option:

Bottom-mounted fitting (DG 101), making it possible to turn the manometer into the direction from which it is viewed, as compared to a fitting mounted on the back (standard).

Function:

When the preset vacuum is reached, the built-in diaphragm switch changes over.

The change-over (CO) switch makes it possible to indicate a broken wire by means of a suitable electronic circuit, as compared to a make contact (normally open / NO) switch.

Function:

Manometer for optical monitoring of the dirt load in return filters.

Green reading area = filter element O.K., Red reading area = filter element clogged.

In order to protect the measuring element from pressure peaks, the unit is provided with a built-in orifice system.

Option

Bottom-mounted fitting, making it possible to turn the manometer into the direction from which it is viewed, as compared to a fitting mounted on the back (standard).

Function:

The diaphragm switch closes resp. opens as soon as the pressure exceeds the preset value.

Accessories:

Suitable protection caps for DG 813 are available under part no. DG 813.0701

(central hole for cable Ø 1.5 up to 5 mm / Ø 0.06 up to 0.20 inch) and

DG 813.0702

(2 holes for cable \varnothing 1.7 up to 2.2 mm / \varnothing 0.07 up to 0.09 inch).

Function:

When the preset back pressure is reached, the built-in diaphragm switch changes over.

The change-over (CO) switch makes it possible to indicate a broken wire by means of a suitable electronic circuit, as compared to a make contact (normally open / NO) switch.

Option:

The transparent socket with 2 built-in LEDs makes it possible to have an additional optical indication of the element contamination. When the operating voltage is switched on, a green LED lights up. When the switching pressure is reached, a yellow LED lights up in addition.

/					jor /					/	/		
		/		Sulfa Sulfa) % %	ies ile	xo ^C	(Mage)	unen	oue	۶ /		
Sag Mo.	/c			bar har	respirition of the second	OF THE	Suite	The state of the s	ind the shift	ild A	inio	Neight	RELIGIES
		,		bar	psi		V AC/DC	A AC/DC	VA/W AC/DC		kg	lbs	
1	2	3	4	!	5	6	7	8	9	10	1	1	12
DG 100-00	•	-	-	-0.25	-3.6	-	-	-	-	1	0.11	0.24	fitting on the back
DG 101-04	•	-	-	-0.25	-3.6	-	-	-	-	1	0.11	0.24	bottom fitting
DG 902-11	-	•	-	-0.15	-2.2	change-over	250/24	6.0/2.0	1500/48	2	0.13	0.29	with protection cap
DG 902-12	-	•	-	-0.25	-3.6	change-over	250/24	6.0/2.0	1500/48	2	0.13	0.29	with protection cap
DG 200-05	•	-	-	+1.0	+14.5	-	-	-	-	1	0.07	0.15	fitting on the back
DG 200-11 ¹	•	-	-	+1.0	+14.5	-	-	-	-	1	0.07	0.15	fitting on the back
DG 200-06	•	-	-	+2.0	+29.0	-	-	-	-	1	0.07	0.15	fitting on the back
DG 200-15 ¹	•	-	-	+2.0	+29.0	-	-	-	-	1	0.07	0.15	fitting on the back
DG 200-16 ²	•	-	-	+2.0	+29.0	-	-	-	-	1	0.07	0.15	fitting on the back
DG 200-10	•	-	-	+2.0	+29.0	-	-	-	-	1	0.07	0.15	bottom fitting
DG 813-00	-	•	-	+1.2	+17.4	make	42/42	4.0/4.0	100/100	3	0.09	0.20	without protection cap
DG 813-03	-	•	-	+1.5	+21.8	make	42/42	4.0/4.0	100/100	3	0.09	0.20	without protection cap
DG 813-01	-	•	-	+2.0	+29.0	make	42/42	4.0/4.0	100/100	3	0.09	0.20	without protection cap
DG 813-05	-	•	-	+2.5	+36.3	make	42/42	4.0/4.0	100/100	3	0.09	0.20	without protection cap
DG 813-20	-	•	-	+1.2	+17.4	break	42/42	4.0/4.0	100/100	4	0.09	0.20	without protection cap
DG 813-21	-	•	-	+2.0	+29.0	break	42/42	4.0/4.0	100/100	4	0.09	0.20	without protection cap
DC 040 04				2.0	20.0		42742	.4.0	400 (405		0.00	0.20	4440.6
DG 819-21	-	•	-	+2.0	+29.0	break	42/42	≤4.0	100/100	4	0.09	0.20	AMP Superseal
DG 819-22	-	•	-	+2.0	+29.0	break	42/42	≤4.0	100/100	4	0.09	0.20	Deutsch DT04-2P
DG 815-01	_	•	_	+1.2	+17.4	change-over	250/30	4.0/4.0	250/60	5	0.13	0.29	incl. socket
DG 815-11	•	•	_	+1.2	+17.4	change-over	-/30	-/0.25	-/3.0	6	0.13	0.29	incl. socket
DG 815-02	_	•	_	+2.0	+29.0	change-over	250/30	4.0/4.0	250/60	5	0.13	0.29	incl. socket
DG 815-12	•	•	-	+2.0	+29.0	change-over	-/30	-/0.25	-/3.0	6	0.13	0.29	incl. socket

¹ For FR 043 / FR 072 (with preformed seals)


Remarks:


- > With return filters, the response/switching pressure of the clogging indicator used must be lower than the cracking pressure of the bypass valve, with suction filters it must be higher.
- > Clogging indicators listed in this chart are standard units. Other designs available on request.

Page 388 www.argo-hytos.com

² For FNA 008 / FNA 016 (as DG 200-06 but without throttle screw)


DG 100 / DG101

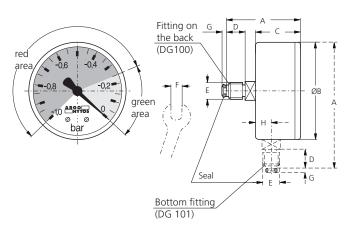


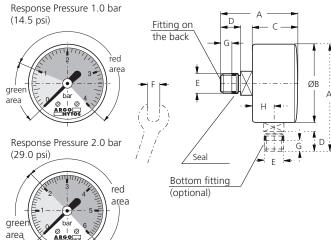


DG 200


DG 813 DG 815

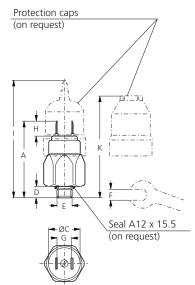

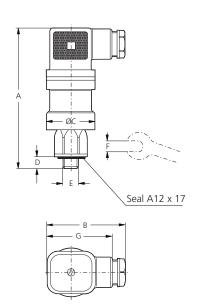

DG 819 DG 902

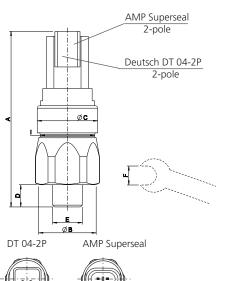

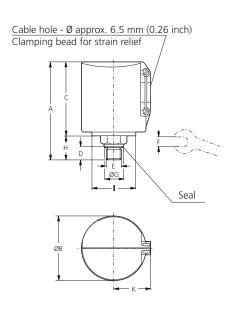

Measurements in mm

Туре	Α	В	С	D	Е	F	G	Н	I	К
DG 100 / 101*	50 / 84*	64	30	13	G¼	14	3.2	10*	-	-
DG 902	76	50	56	10	G¼	21	18.5	20	34	30
DG 200	47 / 59*	41	26 / 24*	12	M12x1.5	14 / 12*	5	9*	-	-
DG 813	55	23.3	24	9	M12x1.5	AF 24	13	9	88	74
DG 815	92	50	34	9	M12x1.5	AF 27	40	-	-	-
DG 819-21	70	23.3	24	9	M12x1.5	AF 24	-	-	-	-
DG 819-22	71	23.3	24	9	M12x1.5	AF 24	-	-	-	-

Measurements in inch

Туре	Α	В	С	D	Е	F	G	Н	- 1	K
						mm				
DG 100 / 101*	1.97 / 3.31*	2.52	1.18	0.51	G¼	14	0.13	0.39*	-	-
DG 902	2.99	1.97	2.20	0.39	G¼	21	0.73	0.79	1.34	1.18
DG 200	1.85 / 2.32*	1.61	1.02 / 0.94*	0.47	M12x1.5	14 / 12*	0.20	0.35*	-	-
DG 813	2.17	0.92	0.94	0.35	M12x1.5	AF 24	0.51	0.35	3.46	2.91
DG 815	3.62	1.97	1.34	0.35	M12x1.5	AF 27	1.57	-	-	-
DG 819-21	2.76	0.92	0.94	0.35	M12x1.5	AF 24	-	-	-	-
DG 819-22	2.80	0.92	0.94	0.35	M12x1.5	AF 24	-	-	-	-


^{*} Bottom fitting


Symbols


1

2

3









4

-- W


5

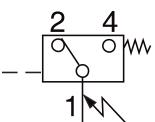

6

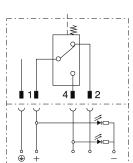

Spare Parts

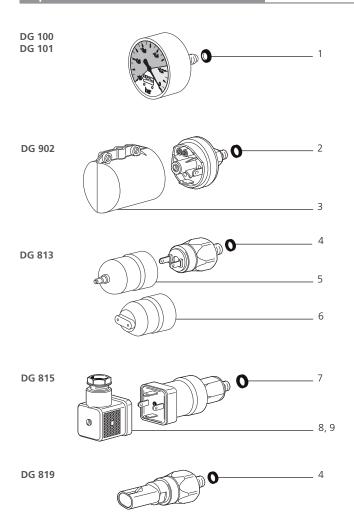

Pos.	Designation	Part No.
1	Seal	DG 100.0101
2	Seal	DG 902.0103
3	Protection cap	DG 902.1701
4	Seal * A12 x 15.5 DIN 7603-Cu	11049900
5	Protection cap *	DG 813.0701
6	Protection cap *	DG 813.0702
7	Seal A12 x 17 DIN 7603-Cu	11164200
8	Socket DIN 43650 - AF3	DG 041.1220
9	Socket with 2 LED DIN 43650 - AF3	DG 041.1200

^{*}Not included in basic unit

The functions of the complete filters as well as the outstanding features of the filter elements assured by ARGO-HYTOS can only be guaranteed if original ARGO-HYTOS spare parts are used.

Quality Assurance

Quality management according to DIN EN ISO 9001

Various quality controls during the production process guarantee the leakfree function and solidity of our products.

 $Illustrations \ may \ sometimes \ differ \ from \ the \ original. \ ARGO-HYTOS \ is \ not \ responsible \ for \ any \ unintentional \ mistake \ in \ this \ specification \ sheet.$